

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


History of original corner establishment:

Corner established by W.B. Barr under GLO Contract No. 443 dated May 29, 1882.

Surveyor General's records state:

Set post 4 ft long 4 ins diam 24 ins in ground for 1/4 Sec corner marked 1/4 S on the West side, from which:

A pine 48 ins diam bears N 14° E 74 lks dist mkd 1/4 S BT  
A pine 16 ins diam bears N 76° W 60 lks dist mkd 1/4 S BT

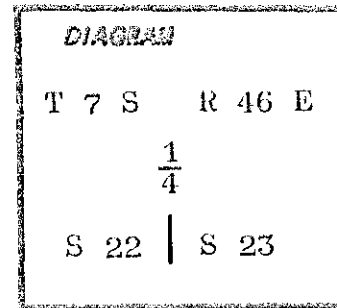

Description of corner evidence found:

A pine 38 ins diam with partially opened blaze for section 22 BT bears N 76° W, 39.6 ft (60 lks) - This tree has been burned and no visible scribing remains. The upper portion of the blaze shows signs of healed blaze.

A fence corner bears West, 3 ft - fence runs south and west.

Description of monument and accessories established to perpetuate the original location of this corner:

Set a 2½ inch brass cap on a 2 inch iron pipe 31 ins long 27 ins in the ground with a 6 ft steel fence post alongside with a sign 54-4 and 2 signs 54-2 attached.

Brass cap marked thus: T 7 S R 46 E

$\frac{1}{4}$   
S 22 | S 23

1979

ORLS 1639

New bearing trees:

A pine 06 ins diam bears S 88° E, 33.5 ft dist mkd 1/4 S 23 BT  
A pine 12 ins diam bears N 55° W, 86.8 ft dist mkd 1/4 S 22 BT

The original bearing tree has a sign 54-3 attached and each new bearing tree has a sign 54-3 attached below a red band of paint and has a brass washer marked LS 1639 nailed flush with BT blaze.

I hereby certify the above corner monument was properly re-established on July 2, 1979 witnessed by Tracy Labaree and Jim DeMastus.

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*William L. Hanley*

OREGON  
JULY 14, 1978  
WILLIAM L. HANLEY  
1839

Office of..... County of.....  
State of..... I hereby certify that the within instrument was filed in this office