


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

K-17

History of original corner establishment:

This corner was originally established by Leland Myers in 1967. See Map No. 10S-35½E-53, and corner certificate.

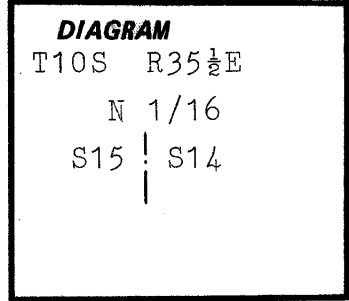

Description of corner evidence found:

Found down monument by Myers. Reset corner position by survey. Based on location poster and scattered rock mound, Myers monument was located very close to corner position by this survey.

Description of monument and accessories established to perpetuate the original location of this corner:

Set a 2½" by 30" aluminum pipe with 2½" aluminum cap 10" in the ground to bedrock and surrounded with a mound of earth and stone. Placed Myers monument inside our new monument. From the new monument:

A 16" Douglas Fir bears N 45½° W - 15.3', scribed: N 1/16 S15 BT.

A 16" Douglas Fir bears S 83½° E - 37.9', scribed: N 1/16 S14 BT.

New bearing trees have a brass washer stamped PLS 1106 nailed to face of blaze. Attached signs 54-3 and 54-9 and painted face of blaze and a 6" red band around each bearing tree.

Set steel fence posts on National Forest Boundary East and South of corner and attached sign 54-9 to one post, and sign 54-2 to both posts.

Used steel tape and staff compass with 19°E declination, measured to the center of the bearing trees.

This corner was remonumented on July 1, 1986.

Witnessed by: Willard Hulick.

**REGISTERED
PROFESSIONAL
LAND SURVEYOR**

William R. Wells

**OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106**

Cap is marked:
T10S R35½E
N 1/16
S15 | S14
1986
PLS 1106

Office of..... County Surveyor..... County of.....
State of..... Oregon....., I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....
..... by
(COUNTY OFFICIAL) (DEPUTY)

FILED 7-21-86
DANER COUNTY SURVEYOR
SURVEY NO 10-35½-182