

**CERTIFIED RECORD OF LAND CORNER MONUMENTATION**

**DIAGRAM**

**HISTORY OF ORIGINAL CORNER ESTABLISHMENT:**

**W-1/16 Corner of Section 28/33**  
No Original Record

**William L Hanley, ORLS No. 1639, 1985**

Set:

A 2 1/2 ins. Aluminum Cap on 2 ins. Aluminum pipe 31 ins. long 27 ins. in ground with surrounding rock mound and 6 ft. steel fence post alongside with 54-4 sign attached.

Establish BT's:

A Fir, 12 ins. in diam., bears S 57 1/2°E, 62.5 ft. dist. marked W 1/16 S33 BT.

A Fir, 12 ins. in diam., bears N 39 1/2°E, 81.8 ft. dist. marked W 1/16 S28 BT.

Attached 54-3 sign to both BT's, with brass washer marked PLS 1639 nailed flush with BT blaze.

**BLM, Lawrence D. Holmes, 1988**

Found:

(Calculated position of Corner established by William L. Hanley bears N 89°20'W, 5.135 chs. dist.,

Set: A stainless steel post, 28 ins. long, 2 1/2 ins.diam., 24 ins. in the ground, with Brass Cap mkd. as shown from which new bearing trees:

A Fir, 16 ins. diam., bears S 46°E., 7 lks. dist., mkd. W 1/16 S33 BT

A Fir, 15 ins. diam., bears N 62°W, 31 lks. dist., mkd. W 1/16 S28 BT.

**DESCRIPTION OF CORNER EVIDENCE FOUND:**


**Robert C. Lamburth, ORLS No. 2367, Glahe & Assoc., 2008**

Found:

3 1/4 ins. BLM Brass Cap on Stainless Steel post, 0.3 ft. above ground, marked as shown, from which:

A Fir, 24 ins. in diam., bears S 46°E, 4.6 ft. dist., with visible scribe

A Fir, 24 ins. in diam., bears N 62°W, 20.5 ft. dist., with visible scribe

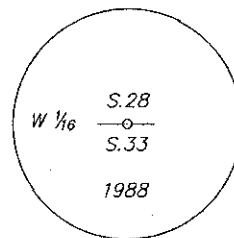

**DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO PERPETUATE THE ORIGINAL LOCATION OF THE CORNER:**

**Robert C. Lamburth, ORLS No. 2367, Glahe & Assoc., 2008**

New BT's:

A Fir, 8 ins. in diam., bears N 72°E, 28.4 ft. dist., scribed W 1/16 S28 BT

A Fir, 25 ins. in diam., bears N 12°E, 35.3 ft. dist., scribed W 1/16 S28 BT

The position of the 2 1/2 ins. Aluminum Cap set by ORLS No.1639 bears N 89°12'59"W, 338.03 ft. dist. from the BLM position. I therefore sawed off the existing monument below ground level, destroyed the marks on the bearing trees, removed all signs and tags and painted over the blazes and existing red paint with black paint.

**CORNER MONUMENT REFERENCES:**

I, Robert C. Lamburth certify that this corner was Properly re-established in 1988 and maintained on 7/09/08, as witnessed by K. Erich Shrack, LSIT

FILED OCTOBER 27, 2008  
BAKER COUNTY SURVEYOR  
SURVEY NO. 6-44-78  
CORNER PRES. NO. 122

