## CERTIFIED RECORD OF LAND CORNER MONUMENTATION

#### History of original corner establishment:

Original corner set by William B. Barr under GLO Contract No. 388, approved December 31, 1881. Record states: Set stake 4 ft. long, 4 in. diam. 18 in ground for  $\mathcal{V}_4$  sec corner from which: Tamarack, 18 in. diam., bears S 60° W, 8 lks. dist.

Tamarack, 20 in. diam., bears N 65° W, 18 lks. dist.

Subsequent Monumentation

William L. Hanley, LS 1639, stated that he found a 1 ins. diam. iron pipe, as described by Survey No. 7-38-20, filed November 18, 1981, in the records of the Baker County Surveyor, and used said pipe to subdivide Section 5.


Corner was ACCEPTED and remonumented by J. David Brinton, LS 2065, as described by Survey No. 7-38-20, filed February 15, 1985, in the records of the Baker County Surveyor.

Record states: Found a 1" iron pin, set approx. 20 ft. west from edge of Anthony Lakes Highway. No evidence of original stake found, road work and fencing in the area have destroyed all traces. The original bearing trees have been lost to road work and fencing in the area.

Because of a logical acceptance of the 1" iron pin by the previous surveyors it is accepted as the

best available evidence of a perpetuation of the original corner position. Set 2-1/2" aluminum pipe with 2-1/2" aluminum cap stamped as shown (below), set 28" in the

ground. Set the 1" iron pin alongside pipe. From which: A Pine, 18" dia., bears N57E., 26.3 ft. scribed 1/4 S32 BT A Pine, 12" dia., bears S36W., 18.7 ft. scribed 1/4 S5 BT

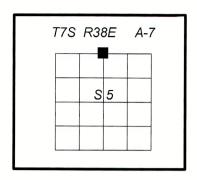


### Description of corner evidence found:

Found 2½ ins. diam. alum. pipe, projecting 3 ins. above ground, with 1" iron pin alongside and a 2½ ins. diam. alum. cap, marked as shown:

Found guard posts ±4 ft. S'ly with Property Boundary (54-2) sign, and ±3.5 ft. W'ly with Property Boundary (54-2) and Attention (54-4) signs attached.

Centerline of Anthony Lakes Highway is ±45 ft. S'ly.

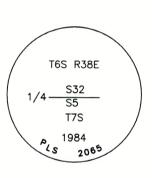

### Description of monument and accessories I established to perpetuate original location of this corner:

New bearing trees:

A ponderosa pine, 11 ins. diam., bears N. 10° E., 54.1 ft. dist., mkd. 1/4 S32 BT.

A ponderosa pine, 9 ins. diam., bears S.  $81/^{\circ}$  E., 96.2 ft. dist., mkd. 1/4 S5 BT. A Douglas fir, 13 ins. diam., bears S.  $661/^{\circ}$  W., 129.6 ft. dist., mkd. 1/4 S5 BT.

A tamarack, 16 ins. diam., bears N. 48° W., 55.4 ft. dist., mkd. 1/4 S32 BT.

All new bearing trees are marked on a single blaze and have a nail with a brass washer stamped "LS 2648" right side center for distance measurements.

Painted 6 ins. red bands and added Bearing Tree (54-3) and Land Survey Monument (54-9) signs as needed to all bearing trees.

Auto C/A geographic position: Lat. 44°59'31.6 N

Long. 118°05'05.5" W

I hereby certify that the corner is monumented and accessories taken as described, using a Warren Knight staff compass, set with 15° East declination, and steel tape on September 2, 2014.

Witnesses: Kristina Powell, Brenda Johnson and Justin Seal

REGISTERED **PROFESSIONAL** LAND SURVEYOR

# eceased

**OREGON** JANUARY 18, 1994 RON C. WALTER 2648

Renewal Date: June 30, 2016

REGISTERED **PROFESSIONAL** LAND SURVEYOR

OREGON

July 22, 1977 WILLIAM R. WELLS 1106

Renewal Date: June 30, 2016

FILED Fab. 25, 2015

BAKER COUNTY SURVEYOR

7-38-108

NOTE: See "Explanation for Successor Certifying Surveyor" statement in Narrative of Record of Survey , CS Nos. 6-38-28 and 7-38-107, filed concurrently with this Land Corner Record.