

NARRATIVE

TO ACCOMPANY SURVEY OF THE $W\frac{1}{2}SE\frac{1}{4}$ IN SEC. 30, T. 7 S., R. 46 E., W.M.


This survey was performed at the request of Auldin Prescott for the purpose of marking the corners of the parcel described above.

The initial point of the survey was the found 5/8-inch rebar marking the SE corner of Section 30, from which survey measurements were made to the pertinent government corners required for the subdivisional parts of the section. Three of these original corners were not found but were evidenced and relocated by assessory cultural ties as follows:

The West quarter corner: Reference is made to Surveyor's Record Book No. 2, pages 28 and 37, wherein the centerline of the county road (formerly referred to as Mrs. L Steele Road) is identical with the East line of Section 30. This line was surveyed on October 27, 1897, by Arthur Curtis, County Surveyor. From this record, the NW corner of the $SW\frac{1}{4}$ of section is relocated along the centerline of the existing county road and in line with an existing east-running fence line.

The Southwest corner $SE\frac{1}{4}$ (South quarter corner): Reference is made to Surveyor's Record Book No. 2, page 25, which indicates the centerline of the county road (formerly referred to as the Fairhurst Road) as being identical with the South line of Sec. 30. From this record, the South quarter corner is relocated at the proportioned East-West distance between adjacent section corners and mid-way between the existing county road right of way fences.

The East quarter corner of section: The original corner location has been destroyed by road construction. Fence lines running West and South have been extended East and North to their calculated point of intersection for the relocated corner position.

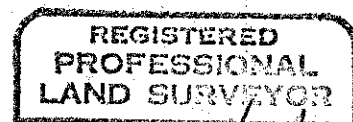

James D. Hanley
OREGON
SEPTEMBER 23, 1977
JAMES D. HANLEY
1206

Sur. No. 7-46-79-A