

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

P-17

History of original corner establishment:

Corner was established by Deputy Herman D. Gradon in 1881, contract #416. Set: Sandstone 14"x10"x7", 9" in ground, 1/4 on West face. Marked: 30" Pine N70E--266 lks.; 36" Pine N70W--62 lks.

Corner was monumented by BLM in 1974 from original evidence. See record field notes.

DIAGRAM

T11S R37E
1/4
S22|S23

Description of corner evidence found:

BLM iron post with a 3" brass cap firmly set in a mound of stone 3' base 16" high. Stamped:
Orig. 30" now down rotted 34" Ponderosa Pine stood N70E--175.6'
No marks remain.


Orig. 36" now down rotted 38" Ponderosa Pine stood N70W--40.9' No marks remain.
BLM 8" now 10" Ponderosa pine N43E--37.6' Healed blaze.
BLM 6" now 7" Juniper S51W--66.0' (record S49W) Scribing visible.

T11S R37E
1/4
S22|S23
1974


Description of monument and accessories I established to perpetuate the original location of this corner:

Chiseled BX0 on top 3'x2'x1' high rock outcrop N66E--25.1'.
Chiseled BX0 on top 3'x2' flush exposed bedrock S46W--29.6'.
Nailed 54-9 and 54-3 signs to BT's, painted bands, blazes and chisel marks red.
Set guard post North with 54-9 sign.

Bearings are magnetic- Declination 20°.

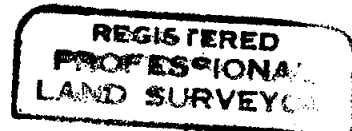

Larry D. Bishop

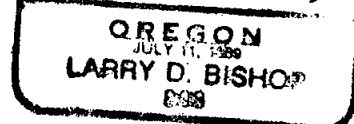

Expires 12/31/95

Office of..... County of.....
State of....., I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....
..... by
(COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

FILED FEB. 4, 1998
BAKER COUNTY SURVEYOR
SURVEY NO. 11-37-89

*GPO-591-971, 1988