

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


History of original corner establishment:

Corner established by W. B. Barr under GLO contract No. 503 dated May 23, 1884.

Surveyor's General records state:

Set slatestone 24 x 12 x 10 ins. 18 ins. in the ground for 1/4 sec cor marked 1/4 on the W side from which;

A fir 8 ins. diam. bears S 85½° W, 80 lks dist marked 1/4 S BT
 A tamarack 6 ins. diam. bears N 86° E, 113 lks dist marked 1/4 S BT

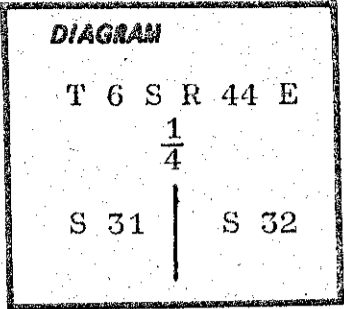

Description of corner evidence found:

A fir 20 ins. diam. with partially healed blaze and visible scribe marks for Section 31 bearing tree.
 No trace of Section 32 bearing tree.
 A broken slatestone in the record location but with no identifiable chisle work.

Description of monument and accessories established to perpetuate the original location of this corner:

Set a 2½ in. brass cap on a 1 in. iron pipe 31 ins. long and projecting 6 ins. out of the ground with a surrounding rock mound.

Brass cap marked thus:

T 6 S R 44 E
1/4
S 31 S 32
CS 1979

New bearing tree:

A fir 13 ins. diam. bears S 61° E, 54.5 ft. dist. marked 1/4 S 32 BT with a sign 54-3 and a sign 54-4 attached and a brass washer marked LS 1639 nailed flush with BT blaze.

I hereby certify that the above corner monument was properly re-established under my supervision on Nov. 1, 1979 and witnessed by Bill Hanley, Tom Fisk and Jim DeMastus.

**REGISTERED
PROFESSIONAL
LAND SURVEYOR**

James D. Hanley
OREGON
 SEPTEMBER 23, 1977
 JAMES D. HANLEY
 1206

County Surveyor Baker
 Office of..... County of.....
 State of Oregon, I hereby certify that the within instrument was filed in this office
 for record on the 5 day of November, 1979
 by
 (COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-5/ (9/71)

FILED Nov. 5, 1979
 BAKER COUNTY SURVEYOR
 SURVEY NO. 6-44-7