

CERTIFIED RECORD OF LAND CORNER MONUMENTATION


History of original corner establishment:

Corner established by W. B. Barr under GLO contract No. 503 dated May 23, 1884.

Surveyor General's records state:

A maple, 3 in. diam., for 1/4 sec. cor., mkd 1/4 S on W. side; from which

A fir, 5 ins. diam. bears S 80° E, 30 lks dist. marked 1/4 S BT
A fir, 7 ins. diam. bears N 62° W, 62 lks dist. marked 1/4 S BT

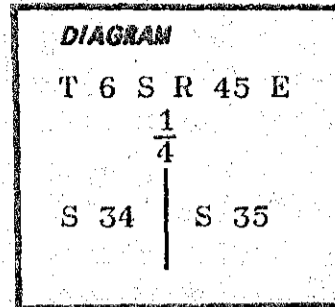

Description of corner evidence found:

None

Description of monument and accessories established to perpetuate the original location of this corner:

At the proportioned corner location set a 2 1/2 inch brass cap on a 2 inch iron pipe, 31 inches long, and projecting 4 inches out of the ground with a surrounding rock mound.

Brass cap marked thus:

T 6 S R 45 E
1/4
S 34 • S 35
ORLS 1639
1980

New bearing trees:

A pine 10 inches diam. bears S 67° W, 14.7 feet marked 1/4 S 34 BT
A fir 9 inches diam. bears S 32° E, 18.7 feet marked 1/4 S 35 BT

Each new bearing tree has a brass washer marked PLS 1639 nailed flush with BT blaze and has a 6 inch band of red paint above upper blaze.

I hereby certify that this corner monument was properly re-established on Oct. 14, 1980, under my direct supervision and witnessed by Brad Gordon and Tom Fisk.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Hanley

OREGON
JULY 14, 1979
WILLIAM R. HANLEY
1639

Office of...County...Surveyor..... County of...Baker.....
State of...Oregon....., I hereby certify that the within instrument was filed in this office
for record on the...16... day of...Oct....., 1980

..... by
(COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-51 (9/71)

FILED Oct. 16, 1980
BAKER COUNTY SURVEYOR
SURVEY NO. 6-45-22

☆ GPO—798-276