


RECORD OF LAND CORNER MONUMENTATION

CORNER: SOUTH 1/4 COR. SECTION 35, T. 7S., R. 38 E., W.M.

ORIGINAL SURVEY BY: Timothy W. Davenport, U.S. Deputy Surveyor

CONTRACT NUMBER: 102

CONTRACT DATE: July 20, 1863

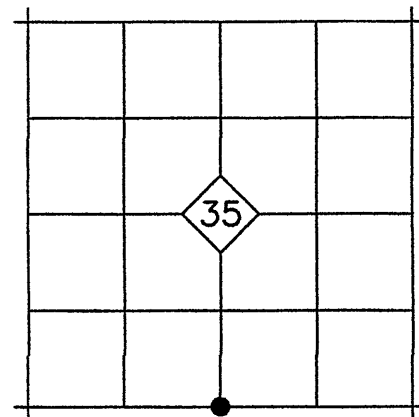

ORIGINAL DESCRIPTION: *Set qr Sec post & made mound of rock*


EVIDENCE FOUND: The corner falls in the gravel surface of Willow Creek Lane, where there is no remaining evidence of the original monument. I declare this corner lost, and reestablish its position by single proportionate measurement between found accepted monuments at the South 1/4 Corner Section 34, and the Southeast Corner of Section 36.

DESCRIPTION OF MONUMENTS AND ACCESSORIES SET AND METHODS USED:

At the corner point, I set a 5/8"x12" iron pin with attached 2-1/2" aluminum cap 13" in the ground. Cap is marked as shown below.

From which, I SET THE FOLLOWING REFERENCE POINTS:

- ▶ A 5/8"x30" iron pin bears N.58°11'E., 32.74 ft. with attached yellow plastic cap marked BENCHMARK SURVEYING.
- ▶ A 5/8"x30" iron pin bears S.46°08'E., 39.52 ft. with attached yellow plastic cap marked BENCHMARK SURVEYING.
- ▶ A 5/8"x30" iron pin bears S.62°20'W., 41.62 ft. with attached yellow plastic cap marked BENCHMARK SURVEYING.
- ▶ A 5/8"x30" iron pin bears N.72°13'W., 24.34 ft. with attached yellow plastic cap marked BENCHMARK SURVEYING.

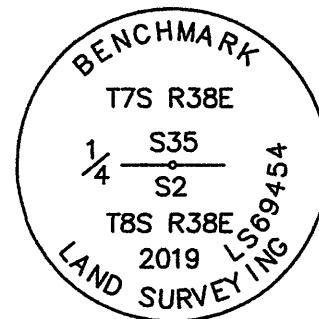

Used RTK GPS to measure the reference points. Bearings are based on Land Partition Plat No. P2020-01.

Work Performed November 26, 2019 by:


Jason L. Hatfield, PLS

BENCHMARK LAND SURVEYING, INC.

1207 Dewey Avenue
Baker City, OR 97814
(541) 523-5852

www.benchmarkls.com

FILED January 21, 2020
BANK COUNTY SURVEYOR
SURVEY NO. 7-38-137
8-38-144

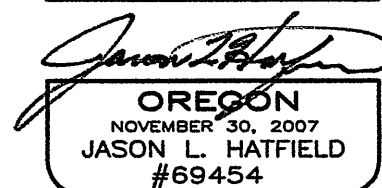

EXPIRES: 6/30/2021