

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner originally established by Timothy W. Davenport under GLO contract number 102 dated July 20, 1863. Surveyor General field notes state:

Set post corner to Secs. 30, 31, 25, and 36. Made mound of Earth and drove charred stake as per inst.

Corner found by James Hanley in Survey Number 07-40-03. Describes corner as a 'Stone Mound'

T 7 S R 39 E V-25

	S	36	

DESCRIPTION OF CORNER EVIDENCE FOUND:

Corner position placed by retracement of Survey Number 07-40-03. Position falls in a cultivated area, however, there are remnants of embedded stone at this location.

DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO MONUMENT THE ORIGINAL LOCATION OF THIS CORNER:

At position determined by retracement of Survey 07-40-03, I set a 5/8"x30" iron pin, 30" in the ground, with 2 1/2" aluminum cap marked as shown below, from which:

NEW BEARING OBJECTS:


A 6 ft tall yellow steel pipe bears North 42°17' East, a distance of 23.72 feet.

An irrigation riser bears North 7°25' West, a distance of 41.00 feet.

Corner falls in a cultivated area. Impractical to set additional accessories.


I hereby certify that the corner was monumented on October 28, 2019.

REGISTERED
PROFESSIONAL
LAND SURVEYOR



OREGON
June 2, 2010
JEFFREY S. HSU
83571

Renewal Date: June 30, 2021

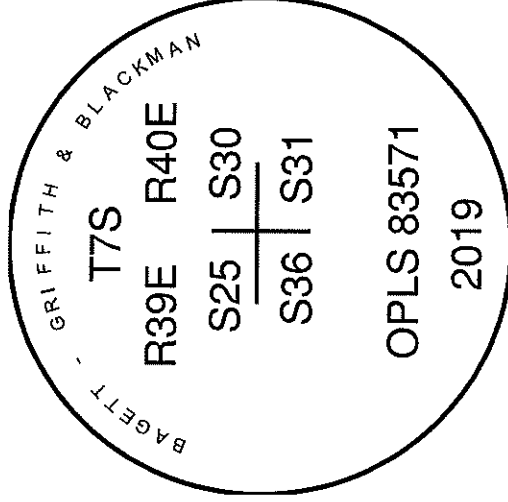

I used a Leica GS-18 RTK GPS in the establishment of the accessories. Bearings and distances are to the center of the accessories. Basis of Bearings is as per Survey for McEst Ranches, as filed with the Baker County Surveyor.