


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

K-5

History of original corner establishment:

None previously established.

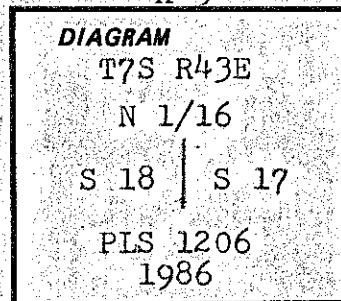

Description of corner evidence found:

None

Description of monument and accessories established to perpetuate the original location of this corner:

Set a 2 1/2" x 30" alum. pipe with a 2 1/2" alum. cap 12" into the ground. Constructed a 36" dia. stone mound around the monument. The cap is marked as shown in the corner diagram. From the corner point:


- A Ponderosa Pine, 11 ins. dia., bears N. 38° E., at 31.8 ft. dist., mkd. N 1/16 S 17 BT.
- A Ponderosa Pine, 28 ins. dia., bears S. 67° W., at 108.9 ft. dist., mkd. N 1/16 S 18 BT.

Set a steel fence post 5 ft. to the South and 5 ft. to the East and attached two 54-2 and one 54-9 signs. Painted the face of the blaze and a 6 in. band around the bearing trees red. I.D. washers were nailed between the scribed B and T of the new bearing trees. The washers are 3/4" in diameter and made of brass with PLS 1206 stamped on one side. Attached USFS 54-9 and 54-3 signs to the bearing trees. Used 18 1/2° declination on a staff compass for readings to the bearing trees. Used a steel tape to measure to a nail set in the side of the trees.

This corner was monumented by proportionate methods to USFS specifications on September 10, 1986, witnessed by Tom Fisk, Larry McBroom and Wade Stone.

Office of County Surveyor County of Baker
 State of OR I hereby certify that the within instrument was filed in this office
 for record on the day of , 19
 by (COUNTY OFFICIAL) (DEPUTY)

Form R6-7100-57 (9/71)

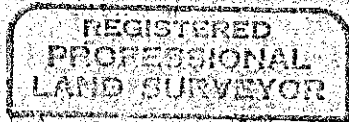

James D. Hanley
 OREGON
 SEPTEMBER 27, 1981
 JAMES D. HANLEY
 1206

☆ GPO-798-276

FILED 10/18/88
 BAKER COUNTY SURVEYOR
 SURVEY NO. 7-43-165