

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Original corner set by Barry B. Barbour, LS 1051, during survey filed with the Baker County Surveyor, file No. 7-44-78, said survey subsequently CANCELLED.

Record states:

At surveyed point set 2 1/2" x 30" aluminum pipe and cap, set pipe 26" in the ground and mound of stone around cap.

From which:

A pine, 11 ins. diam., bears N. 87° E., 16.8 ft. dist., scribed C/E/NE 1/64 S33 BT.

A pine, 9 ins. diam., bears S. 47° W., 12.4 ft. dist., scribed C/E/NE 1/64 S33 BT.

Corner reestablished by Rick E. Tawney, et al, under Group No. 1554, approved April 21, 1992.

Record states

Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 23 ins. in the ground, with brass cap.


From which bearing trees mkd. by Barbour

A pine, 13 ins. diam., bears East, 20 1/2 lks. dist., with scribe marks on partially healed blaze.

A pine, 9 ins. diam., bears S. 51 1/4° W., 22 1/2 lks. dist., with scribe marks on partially healed blaze.

Both bearing trees have brass washers stamped PLS 1051.

Aluminum cap stamped by Barbour, PLS 1051, bears N. 77°27'00" W., 0.050 chs. dist.

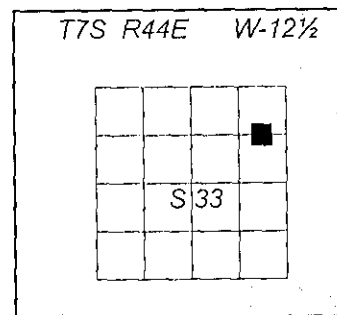

Description of corner evidence found:

Found a 2 1/2 ins. diam. steel pipe with a 3/4 ins. diam. brass cap, firmly set, projecting 3 ins. above ground, mkd. as shown,

From the recovered monument I find the bearing trees mkd. by Barbour

A pine, 16 ins. diam., alive & healthy, bears East, 13.5 ft. dist., with visible scribe on open blaze.

Found a guard post 5 ft. North of recovered monument with Land Survey Monument (54-9) sign attached.

Found Barbour cap 3.3 ft. West of recovered monument.

Description of monument and accessories I established to perpetuate original location of this corner:

New bearing tree

A Douglas fir, 13 ins. diam., bears S. 42° W., 35.5 ft. dist., mkd. 1/64 S33 BT. with washer in side center.

CORS '02 geographic position:


Lat. 44°54'57.7" N
Long. 117°19'25.3" W

All bearing trees are painted with red bands, and have Bearing Tree (54-3) and Land Survey Monument (54-9) signs attached. All new bearing trees have a metal washer stamped "LS 2648" nailed in the side center.

Posted National Forest Boundary N. 8°10'16" E. and S. 89°51'21" E. from corner with Property Boundary (54-2) signs, and a Land Survey Monument (54-9) sign on nearby post.

Witnesses: Kristina Powell, Matt Brockamp and Nick Tressler

Date: August 20, 2009

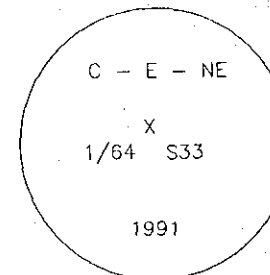

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Ron Walter
OREGON
JANUARY 18, 1994
RON C. WALTER
2648
Renewal Date: June 30, 2010

Office of _____ County Surveyor _____ County of _____ Baker _____

State of _____ Oregon _____, I hereby certify that the within instrument was filed in this office

for record on the _____ day of _____, 20 _____

_____ by _____

(COUNTY OFFICIAL)

(DEPUTY)

FILED Feb. 24, 2010

R6-7100-57 (9/71)

BAKER COUNTY SURVEYOR

SURVEY NO. 7-44-231