


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

Index File Number K-15

History of original corner establishment:

Corner was set by me in 1978 and was re-surveyed in 1982.

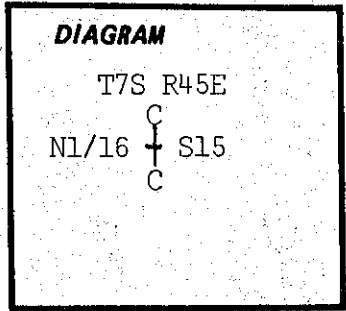

Description of corner evidence found:

The corner was found as described in R6-7100-57 filed with the County Surveyor in 1978.

Description of monument and accessories established to perpetuate the original location of this corner:

The corner was moved 1.01 ft. south and 0.78 ft. west in 1982 to fit the new survey measurements. At surveyed point set 2 1/2" X 30" galvanized pipe and brass cap marked:

Set pipe 25" in the ground and mound of stone around to cap.

From which by magnetic declination of N20°E:

An 18" Fir bears S18°W, 34.8 ft. scribed CN 1/16 S15 BT.

A 12" Tamarack bears N14°W, 67.8 ft. scribed CN 1/16 S15 BT. Painted blazes red and 6" red band around. Placed 54-3s, 54-9s and brass washers stamped PLS 1051 on the bearing trees. Placed 54-2 and 54-9 on a steel fence post 5' east and placed 54-2 and 54-4 on a steel fence post 5' south of the corner. Placed 54-5 on a small tree 10 ft. south of the corner.

```

      RESET 82
      T7S R45E
        |
    C   +   S15
        |
      C
      OR PLS 1051
      1978
  
```

I hereby certify that the above corner monument was reestablished as herein described.

Witnesses: Larry D. Shirley
Terry J. Anderson

September 2, 1982.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Barry B. Barbour

OREGON
OCT. 17, 1975
BARRY B. BARBOUR
1051

Office of.....County Surveyor..... County of.....Baker.....
Oregon
State of....., I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 1985

..... by
(COUNTY OFFICIAL) (DEPUTY)