

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established by W.B. Barr under GLO Contract No: 443 dated May 29, 1882.

Surveyor General's records state:

Set basalt rock 12 X 12 X 8 ins 8 ins in the ground for 1/4 Sec corner marked 1/4 on the North side from which:


A pine 40 ins in diam bears S 73° W 148 lks dist mkd 1/4 S BT

No other trees within limits, dug pits 18 X 18 X 12 ins 5½ ft dist E and W of stone and raised mound of earth 1½ ft high 3½ ft base alongside.

Description of corner evidence found:

A rotten pine with visible ancient axe work bears S 73° W, 97.7 ft (148 lks). No visible scribes.

A basalt stone 12x11x8 inches with identifiable chisle work.

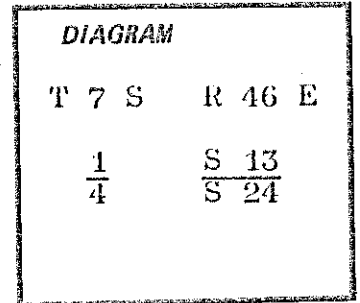

Description of monument and accessories established to perpetuate the original location of this corner:

Set a 2½ inch brass cap on a 2 inch iron pipe 31 ins long 27 ins in the ground with a surrounding rock mound and a 6 ft steel fence post 4 ft West with a sign 54-4 attached.

Brass cap marked thus: T 7 S R 46 E

$\frac{1}{4}$ $\frac{S 13}{S 24}$

1979
ORLS 1639

New bearing trees:

A pine 12 ins diam bears N 09° W, 02.1 ft dist mkd 1/4 S 13 BT
A pine 8 ins diam bears S 40° E, 29.3 ft dist mkd 1/4 S 24 BT

The original BT has a sign 54-3 attached and each new BT has a sign 54-3 attached below a band of red paint and has a brass washer marked LS 1639 nailed flush with the BT blaze.

I hereby certify that the above monument was properly re-established as herein described on July 31, 1979 witnessed by Tracy Labaree and Jim DeMastus.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William L Hanley

OREGON
JULY 14, 1978
WILLIAM L. HANLEY
1639

Office of..... County of.....

State of....., I hereby certify that the within instrument was filed in this office for record on the..... day of....., 19.....

..... by
(COUNTY OFFICIAL) (DEPUTY)