


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner established this survey.

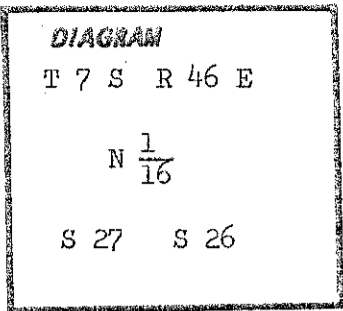

Description of corner evidence found:

A fence corner bears S 74° W., 18.4 ft. dist. from which fence runs south and east.

Description of monument and accessories established to perpetuate the original location of this corner:

Set a 2½ in. brass cap on a 2 in. iron pipe 31 ins. long 26 ins. in the ground with a surrounding rock mound and a 6 ft. steel fence post alongside with a sign 54-9 and 2 signs 54-2 attached. Brass cap marked thus:

T 7 S R 46 E  
 N  $\frac{1}{16}$   
 S 27 S 26  
 ORLS<sup>1979</sup> 1639

New bearing trees:

A pine 8 in. diam. bears N 25° E., 36.7 ft. dist. mkd. N 1/16 S 26 BT  
A pine 12 in. diam. bears N 60° W., 21.8 ft. dist. mkd. N 1/16 S 27 BT

Each new bearing tree has a sign, 54-3, attached below a band of red paint and has a brass washer marked LS 1639 nailed flush with BT blaze.

I hereby certify the above corner monument was properly established by me Sept. 10, 1979. Witnessed by Jim DeMastus and Jeff Townsend.

**REGISTERED  
PROFESSIONAL  
LAND SURVEYOR**

*William L. Hanley*

**OREGON  
JULY 14, 1978  
WILLIAM L. HANLEY  
1639**

Office of..... County of.....  
State of....., I hereby certify that the within instrument was filed in this office  
for record on the..... day of....., 19.....

..... by .....  
(COUNTY OFFICIAL) (DEPUTY)