

**CERTIFIED RECORD OF LAND CORNER MONUMENTATION**

J-21


**History of original corner establishment:**

Corner established by W.B.Barr under GLO contract no. 358 dated June 14, 1880.

Surveyor General records state:

Marked basalt rock 10 x 10 x 6 ins for corner to Sec 11, 12, 13, & 14 as per instructions from which:

- Pine 24 in dia bears N78°W, 30 lks dist.
- Pine 24 in dia bears S40°E, 27 lks dist.
- No other trees.

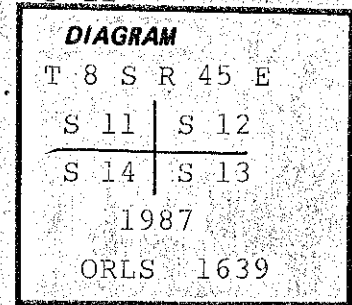

**Description of corner evidence found:**

A sawed pine stump about 30" dia in poor condition for sec 13 BT, found on top of cut slope of road 7705, no scribes identified on rotting face.

**Description of monument and accessories established to perpetuate the original location of this corner:**

At position established by reversed record bearing and distance from found Sec 13 BT stump...

Set a 2½" aluminum cap on 2"x30" aluminum pipe 6" below road surface and a 6' steel fence post on cut bank of road with sign 54-9 attached.

New bearing trees established:

- White fir 14" dia brs N06°E, 14.3' dist marked T8SR45ES12 BT.
- White fir 15" dia brs S58½°E, 42.2' dist marked T8SR45ES13 BT.
- White fir 20" dia brs S07°W, 24.0' dist marked T8SR45ES14 BT.
- White fir 18" dia brs N51½°W, 63.7' dist marked T8SR45ES11 BT.

Each new BT has a band of red paint, painted blaze, a brass washer marked PLS 1639 nailed flush to BT blaze and signs 54-3 & 54-9 attached.

Compass declination 20° East.

I hereby certify that the above described corner monument was properly remonumented by me and witnessed by Jim DeMastus on June 01, 1987.

**REGISTERED  
PROFESSIONAL  
LAND SURVEYOR**

*William L. Hanley*

OREGON  
JULY 14, 1978  
WILLIAM L. HANLEY  
1639

Office of County Surveyor..... County of Baker.....

State of Oregon..... I hereby certify that the within instrument was filed in this office

for record on the..... day of..... 19.....

..... by .....

(COUNTY OFFICIAL)

(DEPUTY)

FILED 12-3-87  
BAKER COUNTY SURVEYOR  
SURVEY NO. 8-45-116