


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

V-19

History of original corner establishment:

This corner was originally established by W.B. Barr, U.S Deputy Surveyor, under his Contract No. 492, dated August 22, 1883, during April, 1884. The original notes state that at the corner a 14"by12"by12" marked basalt stone was set 10" in the ground from which:

- A 36" pine bears N55°E-100 lks, marked 1/4 S BT.
- A 36" pine bears S50°E-14 lks, marked 1/4 S BT.

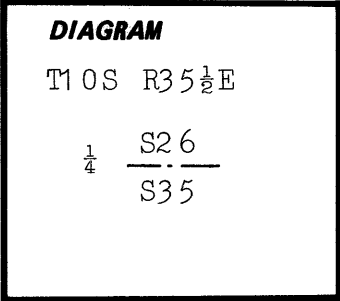

Description of corner evidence found:

A 18"by12"by12" basalt stone, firmly set in ground, marked ¼" on North face from which:

- A 38" pon. pine bears S50°E-10.6' with scribing visible on partly healed double blazes.
- A 36" down pon. pine bears N55°E-66.0'± with scribing visible on partly healed double blazes.

Description of monument and accessories | established to perpetuate the original location of this corner:


Set a 2½" by 30" aluminum pipe with 2½" aluminum cap 24" in the ground and surrounded with a mound of earth and stone. Buried corner stone in the new mound. From the new monument:

A 9" pon. pine bears N15°E-18.7' scribed 1/4 S26 BT.

New bearing tree has a brass washer stamped PLS 1106 nailed to the face of blaze. Attached sign 54-3 and 54-9 and painted face of blaze and a 6" red band around each bearing tree. Set steel fence post West of corner and attached sign 54-9.

Used steel tape and staff compass with 20°E declination, measured to the center of the bearing trees.

Cap is marked:

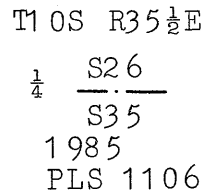

This corner was remonumented on November 6, 1985.

Witness: Willard Hulick.

**REGISTERED
PROFESSIONAL
LAND SURVEYOR**

William R. Wells

**OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106**

County Surveyor _____ County of _____ Baker
 Office of _____
 State of Oregon _____, I hereby certify that the within instrument was filed in this office
 for record on the _____ day of _____, 19____
 _____ by _____
 (COUNTY OFFICIAL) (DEPUTY)

FILED 2-3-86
 BAKER COUNTY SURVEYOR
 SURVEY NO. 10-35½-120