

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of original corner establishment:

Corner was established by William R. Gradon, US Deputy Surveyor, during the original survey Contract No. 409 dated March, 1882.

"Set a basalt stone 18 x 10 x 8 ins. 12 ins in the ground, for cor. to secs 25,26,35&36, marked with 1 notch on S and E edges, from which:
A pine 24 ins diam. bears N40°E 60 lks dist, marked T10S R37E S25 BT.
A tamarack 18 ins diam. bears S34°E, 83 lks dist, marked T10S R37E S36 BT.
A pine 16 ins diam. bears S77°W, 60 lks dist, marked T10S R37E S35 BT.
A pine 14 ins diam. bears N35°W, 48 lks dist, marked T10S R37E S26 BT."

DIAGRAM

T10S R37E

S26 | S25

S35 | S36

**1971
BLM**

In 1971 the Bureau of Land Management monumented the corner as follows:

"The cor. of secs. 25, 26, 35 and 36, determined at record bearing and distance from remains of the original bearing trees:

A root hole, bears N70°E, 60 lks. dist., with a down pine alongside, 30 ins. diam., with scribe marks BT visible on open blaze.

A western larch stump, 24 ins. diam., bears S29°E, 83 lks. dist., no marks visible. (Record, S34°E)

A pine, 24 ins. diam., bears S77°W, 60 lks. dist., with scribe marks T10S R37E S35 BT visible on open blaze.

A pine, 26 ins. diam., bears N35°W, 48 lks. dist., with scribe marks T10S R37E S26 BT visible on open blaze.

At the corner point set an iron post 28 ins. long, 2 1/2 ins. diam., 24 ins. in the ground, with brass cap mkd. as shown on diagram,

from which new bearing trees:

A fir, 10 ins. diam., bears N60°E, 53 lks. dist., mkd. T10S R37E S25 BT.

A ponderosa pine, 10 ins. diam., bears S7°E, 45 1/2 lks. dist., mkd. T10S R37E S36 BT.

A ponderosa pine, 10 ins. diam., bears S50°W, 66 lks. dist., mkd. T10S R37E S35 BT.

A western larch, 9 ins. diam., bears N54°W, 85 1/2 lks. dist., mkd T10S R37E S26 BT.

Bury a cobblestone, 16 x 10 x 8 ins., with an X chiseled on W. face, alongside iron post."

Description of corner evidence found:

Found 1971 BLM brass cap in good condition, stamped as shown on diagram, with steel post set alongside, from which:

A 9" Western Larch, bears N55°45W, 56.5 ft., dead and standing with blaze still visible. (Record, N54°W, 85 1/2 lks.)

Description of monument and accessories I established to perpetuate the original location of this corner:

Maintained corner by attaching "Land Survey Monument" signs to steel post and bearing trees as needed, painting 6" wide red bands around bearing trees, and making new accessories:

A 13" Western Larch, bears S83°W, 65.8 ft., scribed "T10S R37E S35 BT"

A 9" Ponderosa Pine, bears N5°W, 125.1 ft., scribed "T10S R37E S26 BT"

A 10" Western Larch, bears N69°30'E, 124.3 ft., scribed "T10S R37E S25 BT"

A 12" Western Larch, bears S78°30'E, 155.7 ft., scribed "T10S R37E S36 BT"

Sawed off the dead BT to be about 6 feet high. The corner is in an area that was badly burned by a forest fire and nearly all the trees in the immediate area have been killed.


I, Leland Lee Myers, 587 E Auburn Street, PO Box 98, Sumpter, OR 97877, do hereby certify that on November 19, 1994, I maintained the corner as herein described.

FILED IN THE OFFICE OF THE BAKER COUNTY SURVEYOR THIS
7 DAY OF Feb, 1995.

10-37-73

Baker County Surveyor

Client: Lyle Defrees & US Forest Service

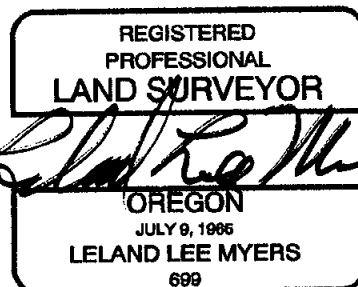

Renewal Date 1/1/97

T10S R37E V-21