

CERTIFIED RECORD OF LAND CORNER MONUMENTATION

X-25


History of original corner establishment:

Corner originally established by Eugene P. McCornack under contract No. 398 and dated July 2, 1881.

Surveyor General records state:

Set basalt stone 14 x 12 x 7", 10" in ground for 1/4 sec Cor marked 1/4 on W face from which:

A pine 30" dia brs S15°E, 89 lks dist marked 1/4S BT.
A pine 24" dia brs S35°W, 82 lks dist marked 1/4S BT.

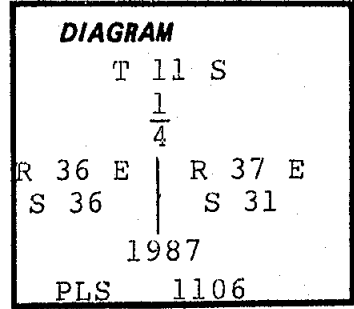

Description of corner evidence found:

None. Searched with 2 person crew with 1 PLS for a total of 8 1/2 hours on 4 occasions. Area has been devastated by fire and logging.

Description of monument and accessories established to perpetuate the original location of this corner:

Re established corner by single proportion measure between found SE and NE corners of Sec. 36...

Set 2 1/2" aluminum pipe with 2 1/2" aluminum cap 22" in the ground and surrounded with a mound of earth and stone. Cap marked as shown in corner diagram.

New bearing trees established:

A 5" ponderosa pine brs S57 1/2°E, 75.9' dist mkd 1/4S31 BT.
A 17" ponderosa pine brs S53 1/2°W, 160.7' dist mkd 1/4S36 BT.

New bearing trees have a brass washer stamped PLS 1106 nailed to face of blaze. Attached signs 54-3 & 54-9, painted face of blaze and 6" band of red around each BT. Set steel fence post N & S of corner and attached sign 54-2 to both posts and 54-9 to one post.

Compass declination 19° East.

I hereby certify that the above corner monument was properly re established to U.S.F.S. standards by me on November 04, 1987.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

William R. Wells

OREGON
JULY 22, 1977
WILLIAM R. WELLS
1106

Office of..... County Surveyor..... County of..... Baker
State of..... Oregon....., I hereby certify that the within instrument was filed in this office
for record on the..... day of....., 19.....

..... by
(COUNTY OFFICIAL) (DEPUTY)