


CERTIFIED RECORD OF LAND CORNER MONUMENTATION

History of Original Corner Establishment:

This 1/4 corner was established by Henry Meldrum, Deputy Surveyor under Contract No. 226 and being dated May 29, 1875. His notes states he set a Basalt stone 18" x 16" x 5" for the 1/4 corner common to Sections 25 & 26, T 12 S, R 39 E W.M.

Description of Corner Evidence Found:


At the location of this one quarter corner I found a Basalt stone measuring 18" x 10" x 5" as shown in the accompanying photo, of which does not fit the description of the stone Henry Meldrum said he had set. However I did identify visible markings of 1/4 on the top center of the stone as shown in the accompanying photo. I can only assume Henry Meldrum made an error in the dimensions of the stone as it does appear to be an original stone.

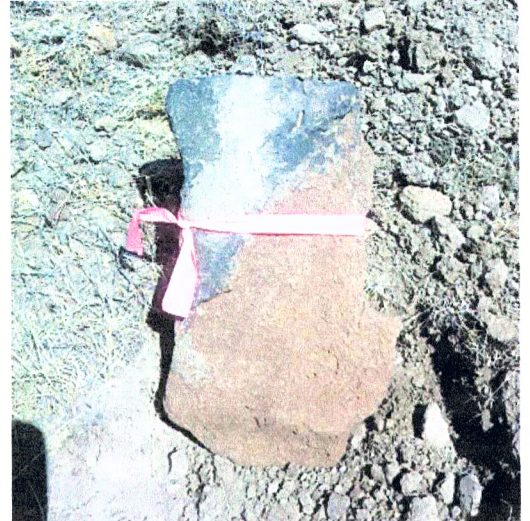

Found a stone 18" x 10" x 5" partially buried and having barely visible markings of 1/4 on the top center portion of the stone as seen in the photo.

Description of Monument and Accessories I Established to Perpetuate the Original Location of Corner:

To perpetuate this 1/4 corner, at the exact location of the stone, I set a 2 inch Brass Cap on a 1" x 30" galvanized iron pipe. I buried the pipe to within 8 inches above the ground surface. The original stone was turned upside down and buried on the West side of the new monument with the face of the stone where the marks appear facing the pipe. I then placed a mound of stone and soil three feet in diameter about the monument. The brass cap monument is stamped as shown in the accompanying photo.

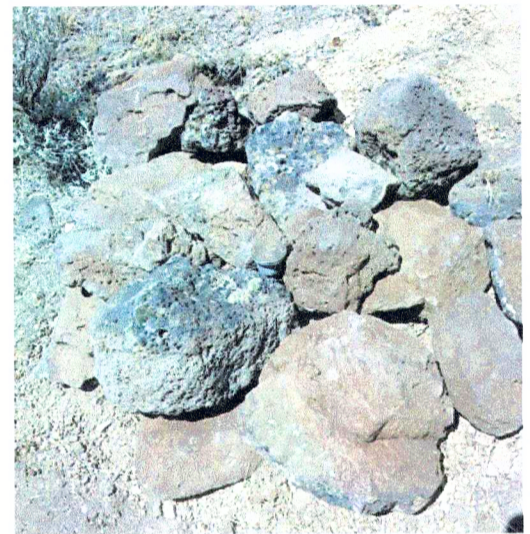

Set brass cap monument to within 8" of the surface in a mound of stone 3 feet at base around monument. Original stone is buried on the West side of monument.

I then set four bearing objects as follows:

Reference No. 1 is a 5/8" x 30" iron rebar with an orange plastic cap stamped Reference Monument which bears North, 18.00 feet distance. Monument pin was driven to within 6 inches above the ground surface.

Reference No. 2 is a 5/8" x 30" iron rebar with an orange plastic cap stamped Reference Monument which bears South, 15.00 feet distance and in direct line with bearing object No. 1. Monument pin was driven to within 6 inches above the ground surface.

Reference No. 3 is a 5/8" x 30" iron rebar with an orange plastic cap stamped Reference Monument which bears East, 15.00 feet distance. Monument pin was driven to within 6 inches above the ground surface.

Reference No. 4 is a 5/8" x 30" iron rebar with an orange plastic cap stamped Reference Monument which bears West, 15.00 feet distance and in direct line with bearing object No. 3. Monument pin was driven to within 6 inches above the ground surface.



Brass Cap as stamped.

This 1/4 corners true geographic position.
44°29'37.97963"N 117°53'27.53987"W NAD83

I, James H. Hambleton certify that this corner was properly reestablished as witnessed by John Eggers on July 25, 2012.

REGISTERED
PROFESSIONAL
LAND SURVEYOR

OREGON
JULY 10, 1964
JAMES H. HAMBLETON
645

Renews June 30, 2014

FILED Sept. 27, 2012
BAKER COUNTY SURVEYOR
SURVEY NO. 12-39-56