
## CERTIFIED RECORD OF LAND CORNER MONUMENTATION

### HISTORY OF ORIGINAL CORNER ESTABLISHED:

Corner was originally established under GLO contract number 148, dated May 17th, 1871, executed by John S. Kincaid. Surveyor General field notes state:

Set stone 17x14x7 for cor. to secs. 9, 10, 3, + 4

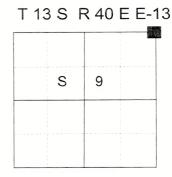

### DESCRIPTION OF CORNER EVIDENCE FOUND:

Found a rock jack, constructed of juniper posts, from which barbed wire fence runs Northwest/Southeast. Juniper posts from an ancient North/South fence line run South from this corner. Within the more modern fence, there are rock jacks with stones of called size, however, I find no marks on any of them. Rock jack is harmonious in position with quarter corners to the North and East.

# DESCRIPTION OF MONUMENT AND ACCESSORIES I ESTABLISHED TO MONUMENT THE ORIGINAL LOCATION OF THIS CORNER:

At position of old fence corner rock jack, I set a 5/8" x 30" iron pin, drilled 20" in the ground and in a 4 ft. diam. mound of stone, with 2 1/2" aluminum cap marked as shown below, from which:

#### NEW BEARING OBJECTS:

A 5/8" x 15" iron pin bears North 35°23 East, a distance of 12.02, with 1 1/2" aluminum cap marked NE RP A 5/8" x 15" iron pin bears South 86°51 East, a distance of 13.56, with 1 1/2" aluminum cap marked SE RP A 5/8" x 15" iron pin bears South 23°34 West, a distance of 14.05, with 1 1/2" aluminum cap marked SW RP A 5/8" x 15" iron pin bears North 61°55 West, a distance of 12.35, with 1 1/2" aluminum cap marked NW RP

S4 S3
S9 S10

2025
OPLS 83571

I hereby certify that the corner was monumented on June 4, 2025

Witness: Kyle Tucker

PROFESSIONAL
LAND SURVEYOR

OREGON
June 2, 2010

JEFFREY S. HSU
83571

Renewal Date: June 30, 2027

I use a Leica GS18 with RTK in the establishment of the new bearing objects. Basis of Bearing is as per the "Oregon Coordinate Reference System Baker Zone". Bearings and distances are measured to the center of the aluminum caps.

E-13

BAKER COUNTY SURVEYOR

BAYEY NO. 13 - 40-18