



# CERTIFICATE OF SURVEY NO. \_\_\_\_\_



S.E. 1/4, SEC. 18, T. 13 S., R. 45 E., W.M.  
BAKER COUNTY, OREGON

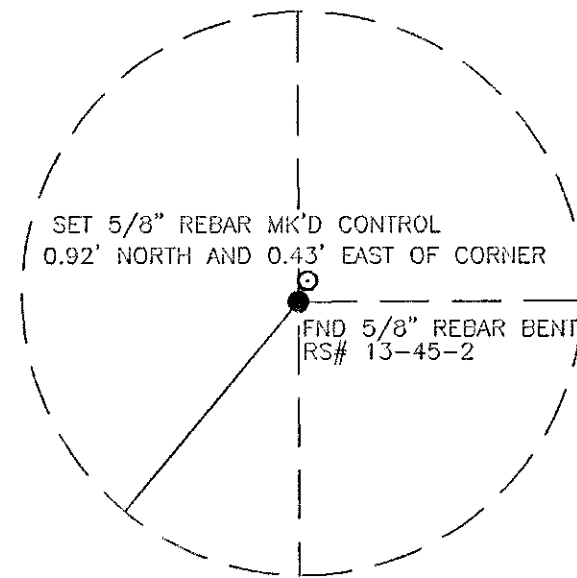

**DETAIL B**  
SCALE 1" = 10'

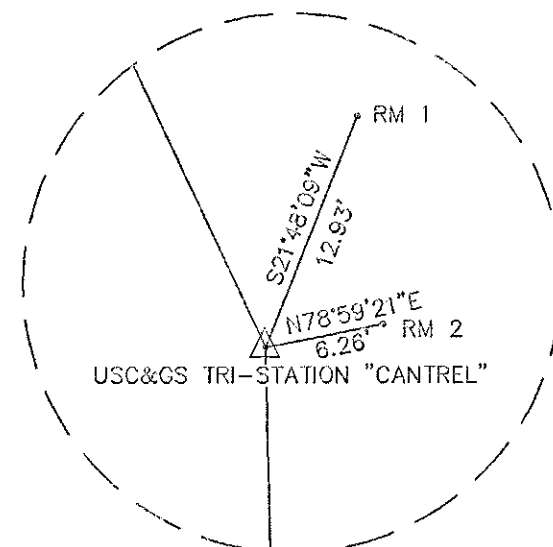

**DETAIL A**  
SCALE 1" = 10'

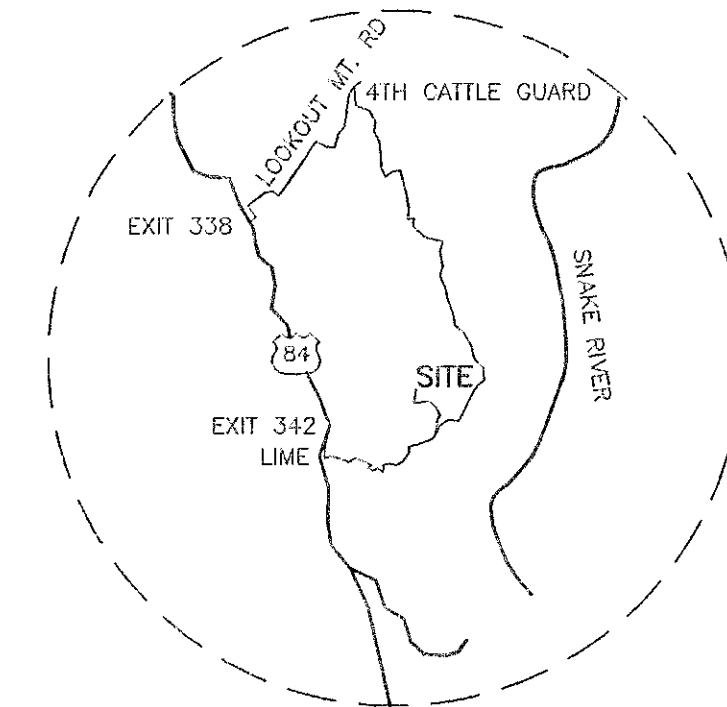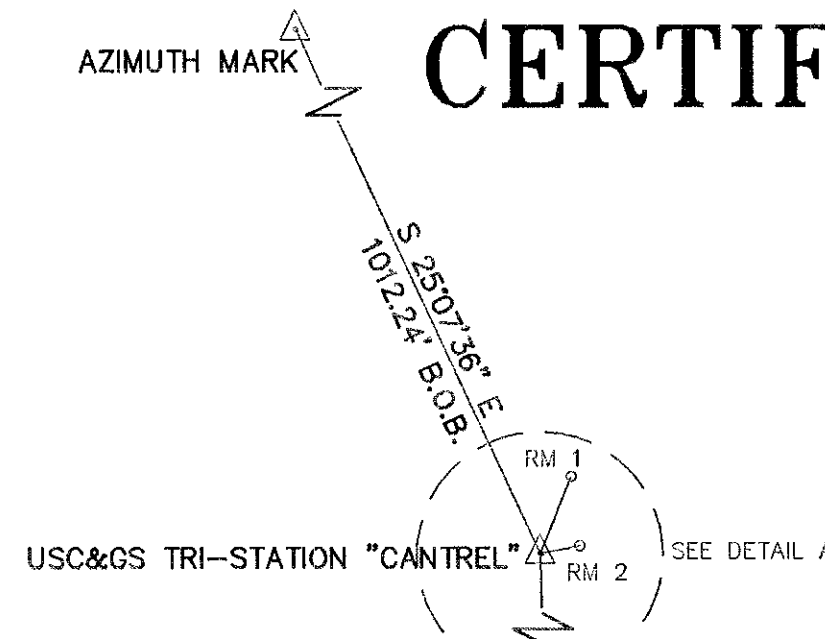

**VICINITY MAP**  
NOT TO SCALE

## DESCRIPTION

THAT PORTION OF THE SOUTHEAST QUARTER OF SECTION 18, TOWNSHIP 13 SOUTH, RANGE 45 EAST, W.M., DESCRIBED AS FOLLOWS:

COMMENCING AT THE SOUTHWEST CORNER OF SECTION 18; THENCE SOUTH 89° 31' 09" EAST 2,642.71 FEET TO THE SOUTH QUARTER CORNER OF SAID SECTION 18; THENCE SOUTH 89° 31' 09" EAST 1,864.40 FEET; THENCE NORTH 00° 09' 24" WEST A DISTANCE OF 94.98 FEET TO A 5/8" AP&A REBAR WHICH IS THE NORTHEAST CORNER OF THE WILLIAMS COMMUNICATIONS SITE; THENCE CONTINUING NORTH 00° 09' 24" WEST A DISTANCE OF 21.62 FEET TO A 5/8" REBAR WITH A YELLOW CAP MARKED LS 1111, BEING THE TRUE POINT OF BEGINNING:

THENCE CONTINUING NORTH 00° 09' 24" WEST 50.00 FEET; THENCE NORTH 89° 50' 36" EAST 50.00 FEET; THENCE SOUTH 00° 09' 24" EAST 50.00 FEET; THENCE SOUTH 89° 50' 36" WEST 50.00 FEET TO THE POINT OF BEGINNING.

TOGETHER WITH AN EASEMENT FOR UTILITIES BEING 8.0 FEET IN WIDTH AND CENTERED ON THE FOLLOWING DESCRIBED LINE:

BEGINNING ON THE WEST LINE OF ABOVE DESCRIBED PARCEL AT A POINT WHICH IS 6.24 FEET NORTH 00° 09' 24" WEST OF THE SOUTHWEST CORNER OF SAID SITE, THENCE SOUTH 78° 16' 32" WEST 59.66 FEET; THENCE NORTH 41° 07' 10" WEST 12.08 FEET TO THE END OF SAID CENTERLINE AND SAID EASEMENT.

TOGETHER WITH AND SUBJECT TO EASEMENTS, RESERVATIONS, RESTRICTIONS AND COVENANTS OF RECORD AND IN VIEW.



SCALE 1" = 30'



**BASIS OF BEARING**  
GEODETIC NORTH  
**EQUIPMENT USED**  
TRIMBLE 4000SSI - RTK

## LEGEND

- = SET 5/8" REBAR LS1111
- = FOUND 5/8" REBAR OR AS INDICATED
- B.O.B. = BASIS OF BEARING
- Ø(NS) = NOT FOUND OR SET
- △ = TRI-STATION
- (M) = MEASURED
- (R) = RECORD
- RS# = RECORD SURVEY NO.

## SURVEYOR'S NARRATIVE

THE PURPOSE OF THIS SURVEY IS TO DEPICT A SITE FOR RADIO COMMUNICATIONS. I USED SURVEYS OF RECORD 13-45-2 AND 13-45-3 TO FIND AND IDENTIFY MONUMENTS. I USED THE GEODETIC BEARING FROM USC&GS STATION "CANTREL" AND THE AZIMUTH MARK TO CHECK MY GPS EQUIPMENT AND FOUND IT TO BE WITHIN 1". I BELIEVE ALL THREE GLO CORNERS I TIED TO TO BE IN THE ORIGINAL POSITIONS EVEN THOUGH I DID NOT POSITIVELY IDENTIFY MARKS.

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR  
*Robert H. Stratton*  
OREGON  
JUL 22, 1977  
ROBERT H. STRATTON  
1111  
RENEWAL DATE: 06/30/98

## SURVEY FOR

**U.S. CELLULAR  
LIME HILL SITE**

## INDEX

| 1/4 | SEC | T.   | R.   |
|-----|-----|------|------|
|     | 18  | 13 S | 45 E |

FILED NOV 7 1997  
BAKER COUNTY SURVEYOR  
SURVEY NO. 13-45-5

**STRATTON SURVEYING & MAPPING**  
7525 W. DESCHUTES PL. UNIT 1C  
KENNEWICK, WA 99336  
(509) 735-7364  
FAX: (509) 735-6560  
survey@3-cities.com

|                |             |
|----------------|-------------|
| 2426RS-1.DWG   | SHT. 1 OF 1 |
| DATE: 10/27/97 | JOB # 2426  |
| DRAWN BY: DBE  |             |